


SPEEDO / GAUGE WIRING KIT


(Must convert all electrical components to 12 volts on vehicles prior to 1967)

<u>Wire Color</u>	<u>Wire Gauge</u>	<u>Printing</u>	<u>Function</u>
Tan	18	Gas gauge	Fuel tank sender to fuel gauge (1968 +up).
Pink	18	12V Ignition	Main power from panel #14 (GAUGES) to cluster lights and fuel gauge vibrator.
Dark blue	18	Generator warning light	Generator warning light from regulator to speedometer cluster "GEN" indicator light.
Black	16	Gas tank gnd	Fuel gauge sender ground wire.
Dark blue	18	Oil pressure sender	Oil pressure sender to speedometer cluster "OIL" oil pressure indicator light.
Dark green	18	Engine temp sender	Optional aftermarket engine temperature sender to an optional engine temp gauge.
Black	16	Ground	Speedometer housing ground wire.
White	16	Coil -> tach	Ignition coil to an optional aftermarket tachometer.


1962-65 Beetle - Speedometer Cluster Diagram

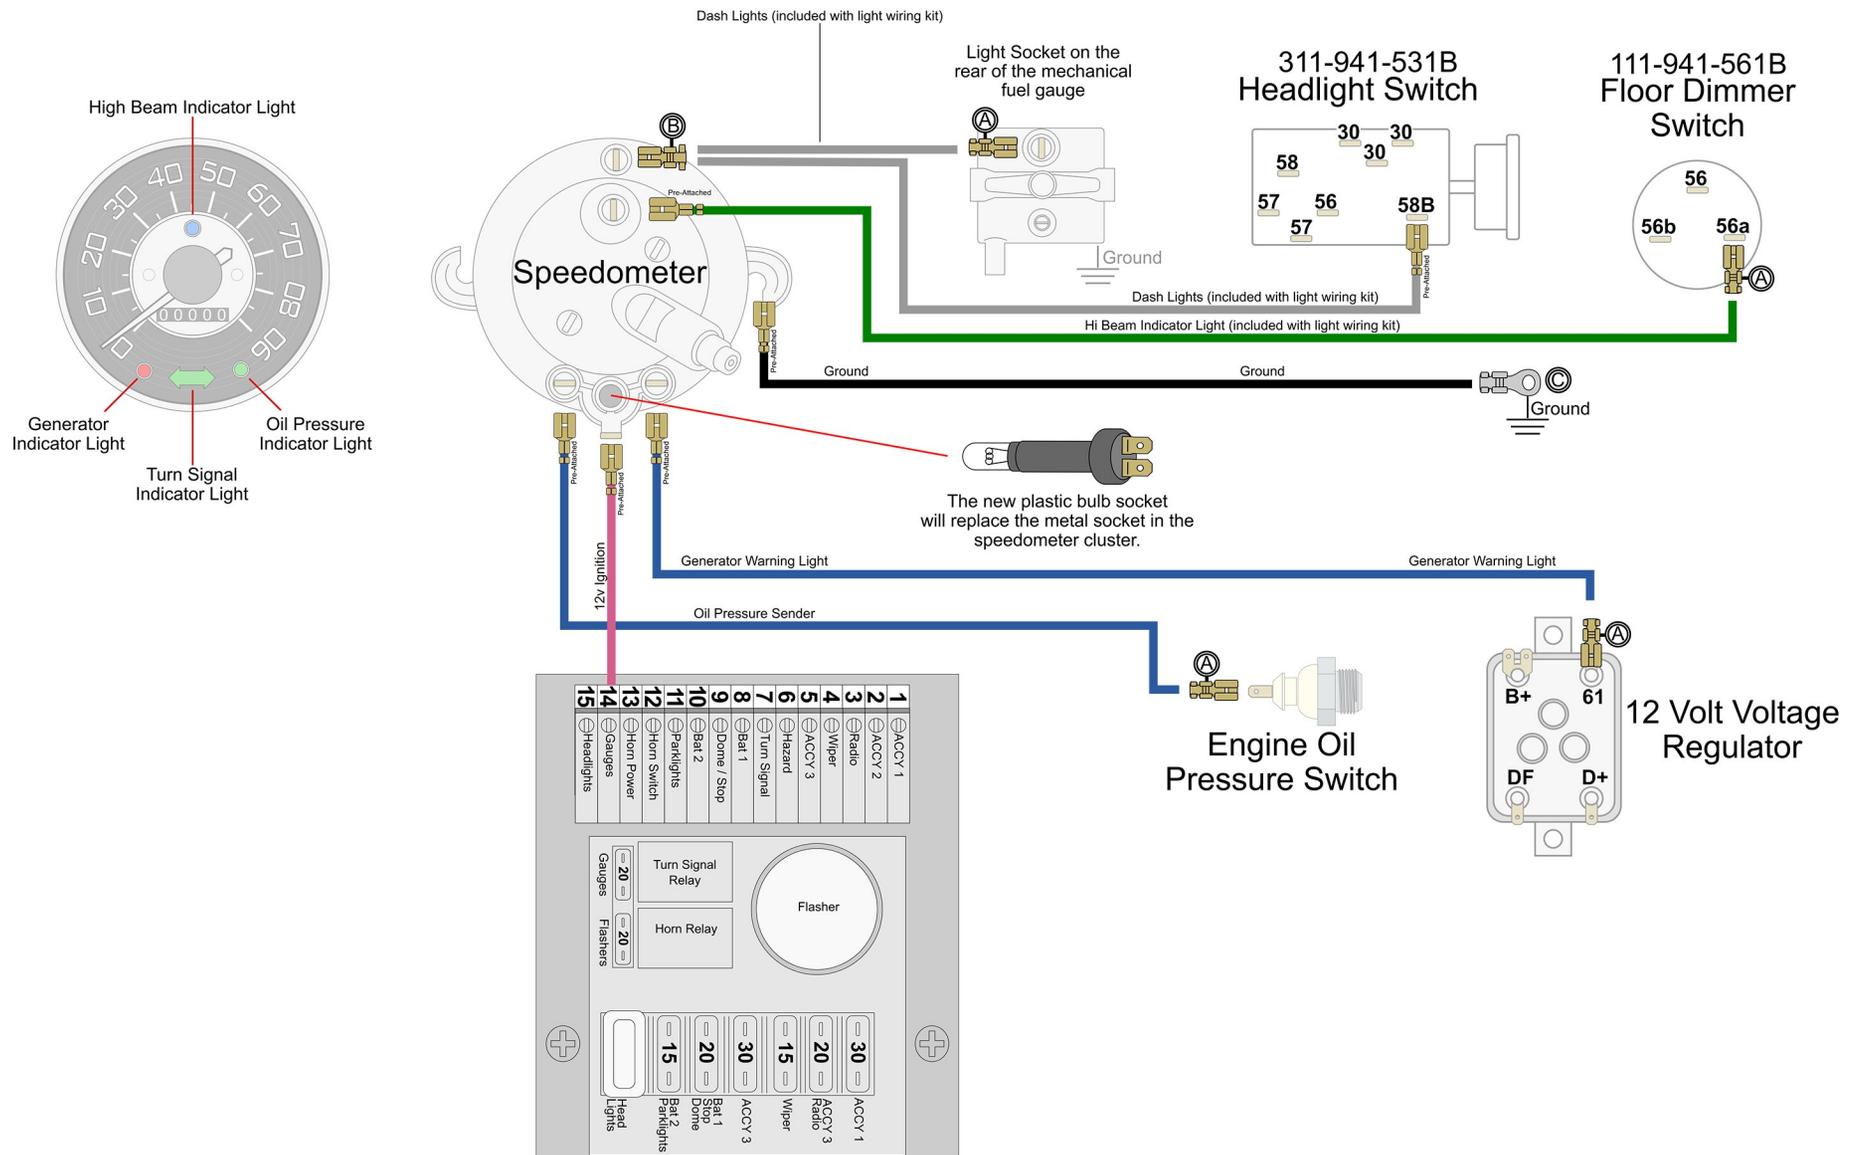

1966-67 Beetle - Speedometer Cluster Diagram

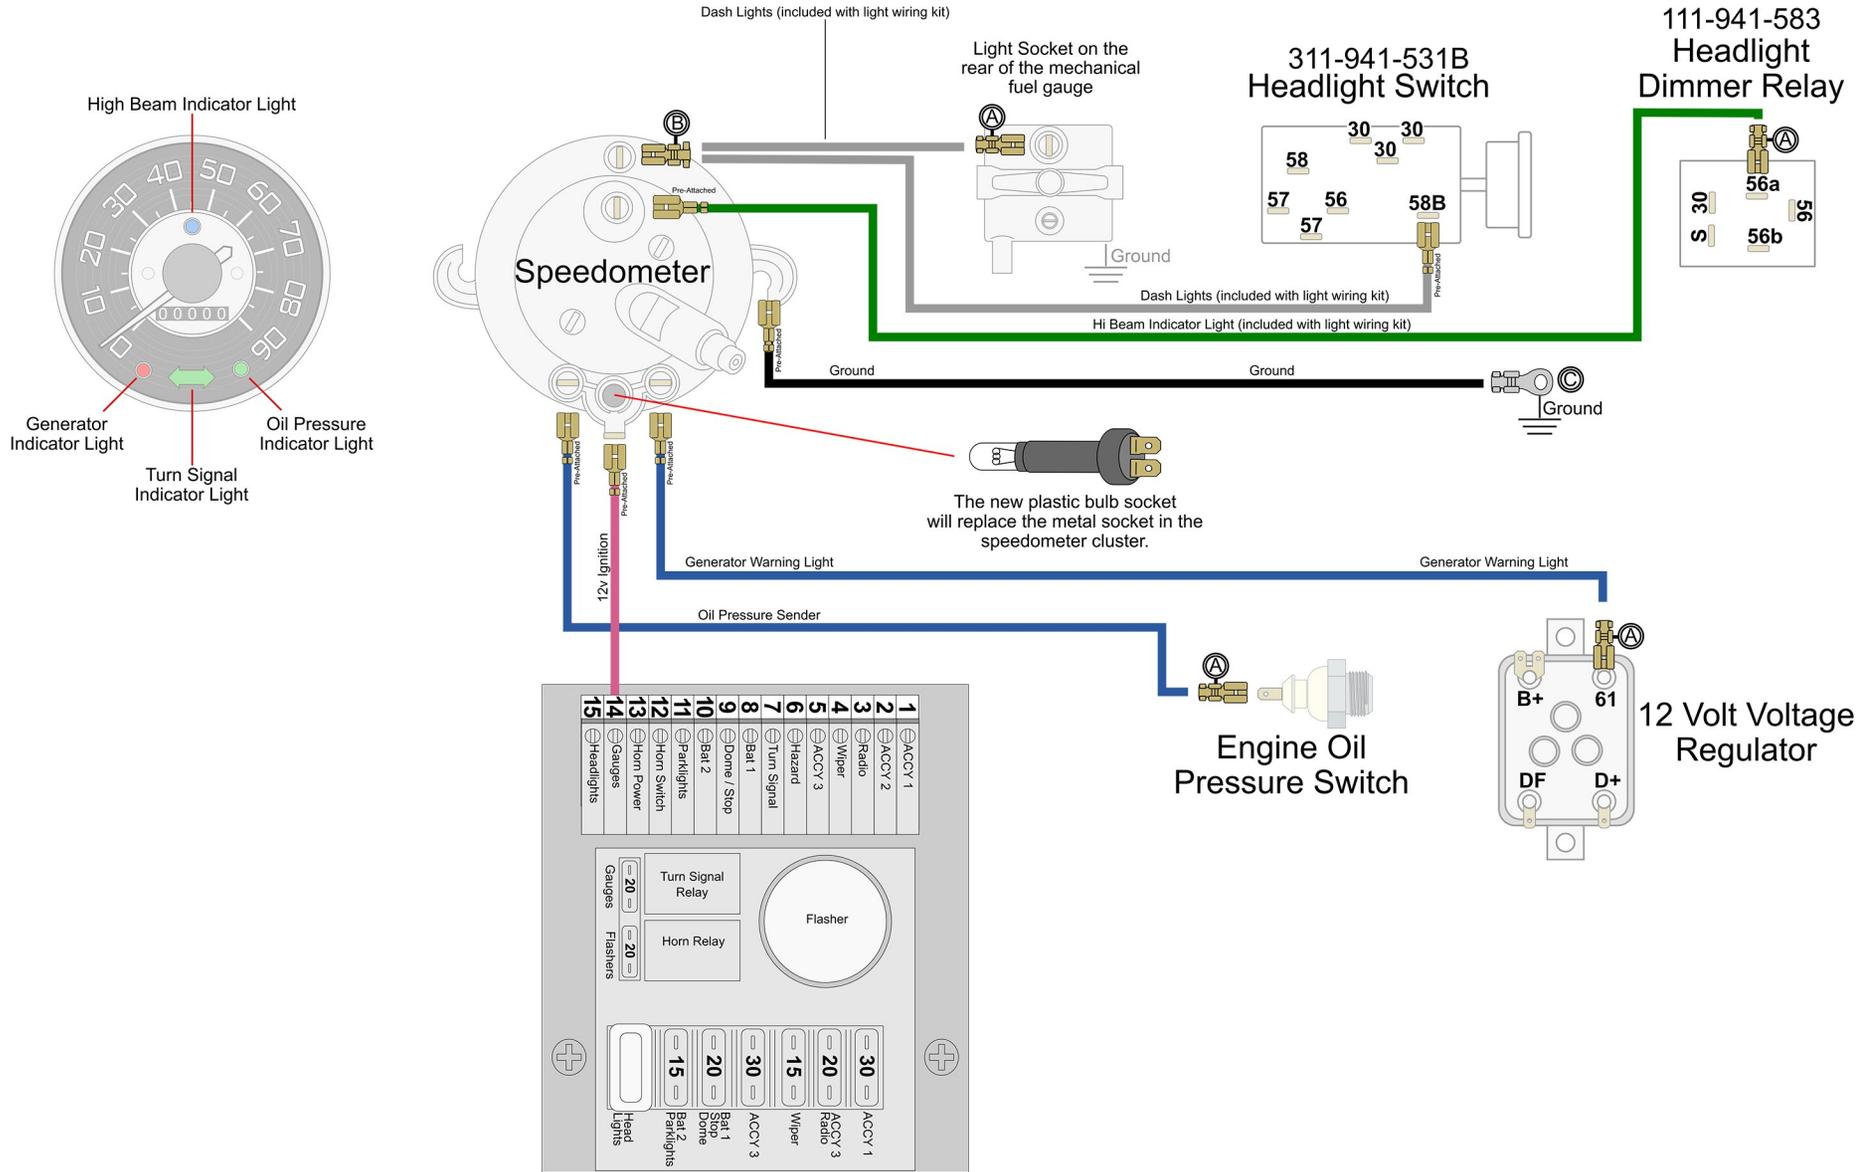

1968-71 Beetle - Speedometer Cluster Diagram

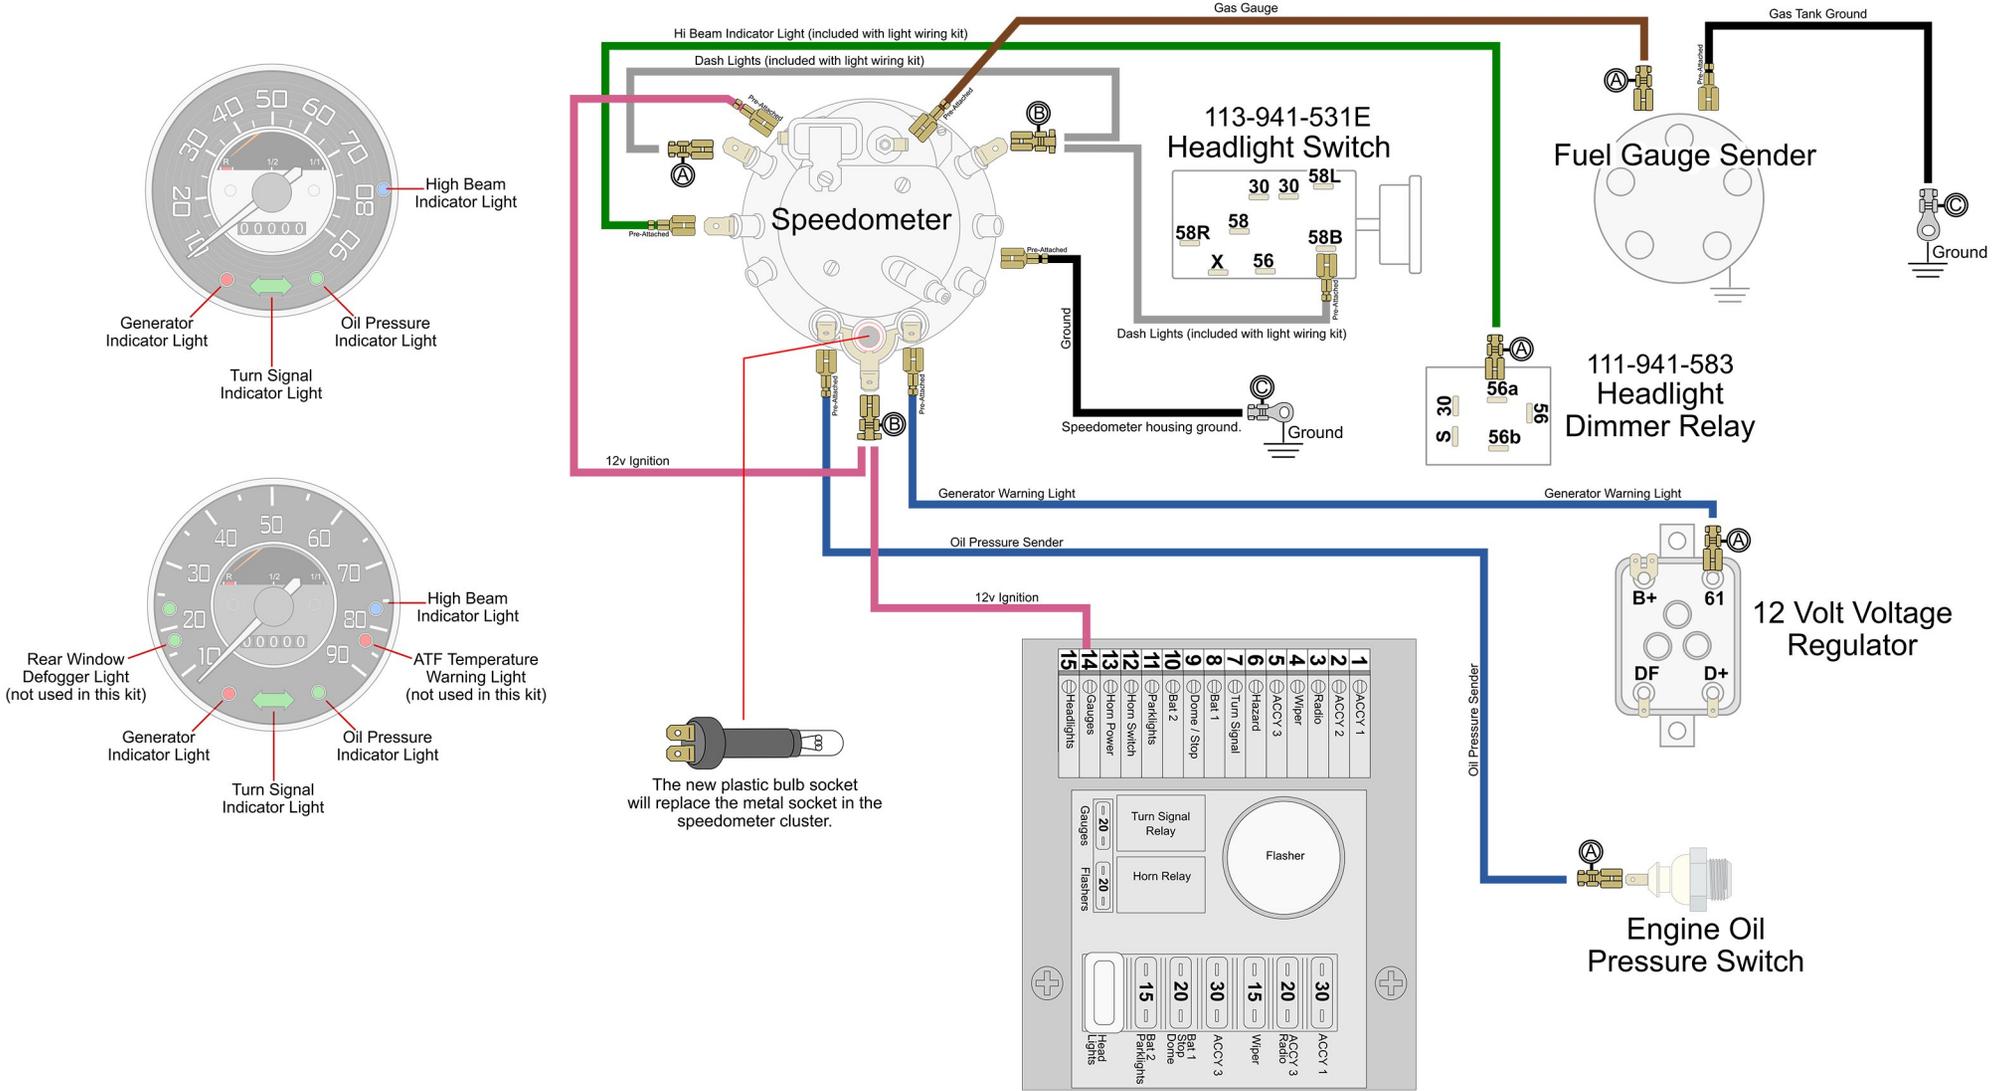

1972-74 Beetle - Speedometer Cluster Diagram

